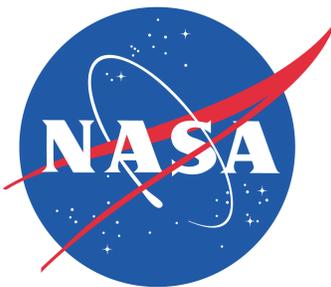


GROUNDWATER MONITORING REPORT

JULY 2001

NATIONAL AERONAUTICS AND SPACE ADMINISTRATION

JET PROPULSION LABORATORY
PASADENA, CALIFORNIA



Contract No. N68711-98-D-5537, D.O. No. 0012-01

Naval Facilities Engineering Command
1220 Pacific Highway, Building 127
San Diego, CA 92132-5187

Prepared by:

SOTA Environmental Technology, Inc.
16835 West Bernardo Drive, Suite 212
San Diego, CA 92127-1613

Project No. 00HW019

Version: Final
October 9, 2001



**GROUNDWATER
MONITORING REPORT
JULY 2001**

**NATIONAL AERONAUTICS AND SPACE ADMINISTRATION
JET PROPULSION LABORATORY
4800 Oak Grove Drive
Pasadena, California 91109**

Contract No. N68711-98-D-5537 D.O. No. 0012-01


**Naval Facilities Engineering Command
1220 Pacific Highway
San Diego, California 92132-5187**


Prepared by:

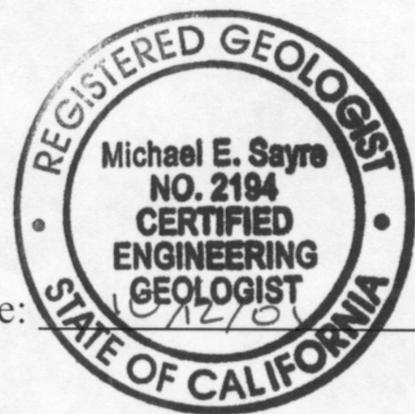
**SOTA Environmental Technology, Inc.
16835 West Bernardo Drive, Suite 212
San Diego, California 92127-1613**

Version: Final
October 12, 2001

Signature: 
Mike Sayre, R.G., C.E.G., Project Geologist

Signature: 
Carl Schubert, Ph.D., QA Director

Signature: 
Dakshana Murthy, Ph.D., P.E., Program Manager

Date: 
10/12/01

Date: 10/15/01

Date: 10/15/01

TABLE OF CONTENTS

Section	Page
LIST OF TABLES.....	ii
LIST OF FIGURES	ii
LIST OF APPENDICES.....	v
ACRONYMS/ABBREVIATIONS	vi
EXECUTIVE SUMMARY.....	viii
1.0 INTRODUCTION.....	1
2.0 FIELD SAMPLING PROCEDURES	3
2.1 Shallow Monitoring Wells	3
2.2 Deep Multi-Port Monitoring Wells.....	3
2.3 Field Quality Assurance/Quality Control Samples.....	4
3.0 ANALYTICAL RESULTS	6
3.1 Volatile Organic Compounds Results.....	6
3.2 Perchlorate Results	7
3.3 Metals Results	7
3.4 Quality Assurance/Quality Control Results	8
4.0 DATA VERIFICATION AND VALIDATION.....	9
4.1 Data Verification	9
4.2 Data Validation.....	9
4.3 Data Validation Qualifiers	9
5.0 WATER-LEVEL MEASUREMENTS	10
6.0 CONCLUSIONS AND RECOMMENDATIONS	11
7.0 REFERENCES.....	12

LIST OF TABLES

Table 1-1	Summary of Well Construction Details for JPL Groundwater Monitoring Wells
Table 3-1	Summary of Analyses Performed on Groundwater Samples Collected from JPL Monitoring Wells, July 2001
Table 3-2	Location of Well Screens in Aquifer Layers
Table 3-3	Summary of Volatile Organic Compounds and Perchlorate Detected in Groundwater Samples Collected from JPL Monitoring Wells, July 2001
Table 3-4	Summary of Volatile Organic Compounds and Perchlorate Detected During the JPL Monitoring Program
Table 3-5	Results of Metals Analyses of Groundwater Samples Collected from JPL Monitoring Wells, July 2001
Table 3-6	Summary of Metals Detected During the JPL Monitoring Program
Table 5-1	Groundwater Monitoring Well Water-Level Measurements, July 2-3, 2001
Table 5-2	Groundwater Monitoring Well Water-Level Measurements, August 1, 2001

LIST OF FIGURES

Figure 1-1	Locations of JPL Groundwater Monitoring Wells and Nearby Municipal Production Wells
Figure 3-1	Contours of Carbon Tetrachloride Concentrations in Aquifer Layer 1, July 2001
Figure 3-2	Contours of Carbon Tetrachloride Concentrations in Aquifer Layer 2, July 2001
Figure 3-3	Contours of Carbon Tetrachloride Concentrations in Aquifer Layer 3, July 2001
Figure 3-4	Contours of Trichloroethene Concentrations in Aquifer Layer 1, July 2001
Figure 3-5	Concentrations of Trichloroethene in Aquifer Layer 2, July 2001
Figure 3-6	Contours of Trichloroethene Concentrations in Aquifer Layer 3, July 2001
Figure 3-7	Concentrations of Tetrachloroethene in Aquifer Layer 1, July 2001

- Figure 3-8 Concentrations of Tetrachloroethene in Aquifer Layer 2, July 2001
- Figure 3-9 Contours of Tetrachloroethene Concentrations in Aquifer Layer 3, July 2001
- Figure 3-10 Contours of Perchlorate Concentrations in Aquifer Layer 1, July 2001
- Figure 3-11 Contours of Perchlorate Concentrations in Aquifer Layer 2, July 2001
- Figure 3-12 Contours of Perchlorate Concentrations in Aquifer Layer 3, July 2001
- Figure 3-13 Carbon Tetrachloride Detected at MW-3 from Aug/Sep 1996 to July 2001
- Figure 3-14 Perchlorate Detected at MW-3 from Aug/Sep 1996 to July 2001
- Figure 3-15 Carbon Tetrachloride Detected at MW-4 from Aug/Sep 1996 to July 2001
- Figure 3-16 Trichloroethene Detected at MW-4 from Aug/Sep 1996 to July 2001
- Figure 3-17 1,2-DCA Detected at MW-4 from Aug/Sep 1996 to July 2001
- Figure 3-18 Perchlorate Detected at MW-4 from Aug/Sep 1996 to July 2001
- Figure 3-19 Perchlorate Detected at MW-5 from Aug/Sep 1996 to July 2001
- Figure 3-20 Carbon Tetrachloride Detected at MW-7 from Aug/Sep 1996 to July 2001
- Figure 3-21 Trichloroethene Detected at MW-7 from Aug/Sep 1996 to July 2001
- Figure 3-22 1,2-DCA Detected at MW-7 from Aug/Sep 1996 to July 2001
- Figure 3-23 Perchlorate Detected at MW-7 from Aug/Sep 1996 to April 2001
- Figure 3-24 Carbon Tetrachloride Detected at MW-8 from Aug/Sep 1996 to July 2001
- Figure 3-25 Perchlorate Detected at MW-8 from Aug/Sep 1996 to July 2001
- Figure 3-26 Carbon Tetrachloride Detected at MW-10 from Aug/Sep 1996 to July 2001
- Figure 3-27 Trichloroethene Detected at MW-10 from Aug/Sep 1996 to July 2001
- Figure 3-28 Perchlorate Detected at MW-10 from Aug/Sep 1996 to July 2001
- Figure 3-29 Carbon Tetrachloride Detected at MW-11 from Aug/Sep 1996 to July 2001
- Figure 3-30 Carbon Tetrachloride Detected at MW-12 from Aug/Sep 1996 to July 2001
- Figure 3-31 Carbon Tetrachloride Detected at MW-13 from Aug/Sep 1996 to July 2001
- Figure 3-32 Trichloroethene Detected at MW-13 from Aug/Sep 1996 to July 2001
- Figure 3-33 1,2-DCA Detected at MW-13 from Aug/Sep 1996 to July 2001

- Figure 3-34 Perchlorate Detected at MW-13 from Aug/Sep 1996 to July 2001
- Figure 3-35 Carbon Tetrachloride Detected at MW-16 from Aug/Sep 1996 to July 2001
- Figure 3-36 Trichloroethene Detected at MW-16 from Aug/Sep 1996 to July 2001
- Figure 3-37 1,2-DCA Detected at MW-16 from Aug/Sep 1996 to July 2001
- Figure 3-38 Perchlorate Detected at MW-16 from Aug/Sep 1996 to July 2001
- Figure 3-39 Carbon Tetrachloride Detected at MW-17 from Aug/Sep 1996 to July 2001
- Figure 3-40 Trichloroethene Detected at MW-17 from Aug/Sep 1996 to July 2001
- Figure 3-41 Perchlorate Detected at MW-17 from Aug/Sep 1996 to July 2001
- Figure 3-42 Carbon Tetrachloride Detected at MW-18 from Aug/Sep 1996 to July 2001
- Figure 3-43 Trichloroethene Detected at MW-18 from Aug/Sep 1996 to July 2001
- Figure 3-44 Perchlorate Detected at MW-18 from Aug/Sep 1996 to July 2001
- Figure 3-45 Perchlorate Detected at MW-20 from Aug/Sep 1996 to July 2001
- Figure 3-46 Trichloroethene Detected at MW-21 from Aug/Sep 1996 to July 2001
- Figure 3-47 PCE Detected at MW-21 from Aug/Sep 1996 to July 2001
- Figure 3-48 Perchlorate Detected at MW-21 from Aug/Sep 1996 to July 2001
- Figure 3-49 Carbon Tetrachloride Detected at MW-23 from Aug/Sep 1996 to July 2001
- Figure 3-50 Trichloroethene Detected at MW-23 from Aug/Sep 1996 to July 2001
- Figure 3-51 Perchlorate Detected at MW-23 from Aug/Sep 1996 to July 2001
- Figure 3-52 Carbon Tetrachloride Detected at MW-24 from Aug/Sep 1996 to July 2001
- Figure 3-53 Trichloroethene Detected at MW-24 from Aug/Sep 1996 to July 2001
- Figure 3-54 Perchlorate Detected at MW-24 from Aug/Sep 1996 to July 2001
- Figure 5-1 Water-Table Elevation Contour Map, July 2-3, 2001
- Figure 5-2 Water-Table Elevation Contour Map, August 1, 2001
- Figure 5-3 Hydraulic Head Elevations from Deep Multi-Port Wells, July 2-3, 2001
- Figure 5-4 Hydraulic Head Elevations from Deep Multi-Port Wells, August 1, 2001